



SERVICE BULLETIN

Service and Maintenance manual N° All

Bulletin N° 004/July/09

Equipment affected:

All ISP manufactured products including Lifejackets and Bladder Assemblies fitted with **HALKEY ROBERTS ALPHA 9000 OPERATING HEADS**

Reason for issue:

Notification of Safety Information issued by the Manufacturer of **HALKEY ROBERTS ALPHA 9000 OPERATING HEADS**

Materiel required:

ISP Part Number 90-ISP-9IX-014

This bulletin is effective:

From: Immediate
To: Until Further Notice

Instruction :

When fitting (or re-fitting) a CO₂ cylinder to a Halkey Roberts Alpha 9000 operating mechanism (Illustration 1) on an ISP manufactured product and the cylinder sealing gasket or 'O' ring is damaged and needs replacing, the replacement seal that should be used is the 'tabbed gasket washer' (Illustration 2). The 'tabbed gasket washer' is to be used in place of the black 'O' ring cylinder seal and the white 'O' ring cylinder seal that were fitted to earlier versions of the Alpha 9000 operating mechanism.

The ISP Part Number for the 'tabbed gasket washer' is 90-ISP-9IX-014

Illustration 1


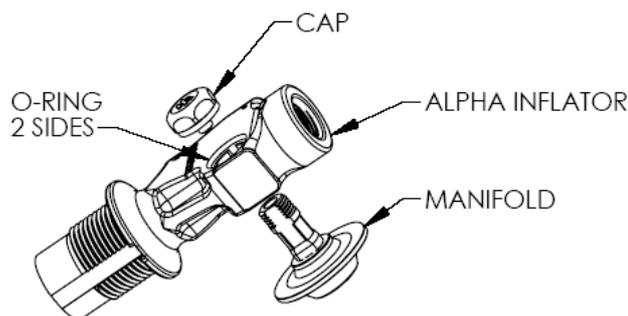


Illustration 2

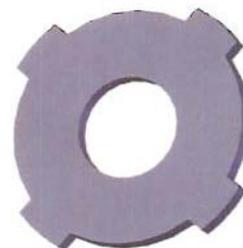

Authorised by :

Name (print) : Paul Houghton

Signature : 

Position : Technical Manager

Date : 14th July 2009

All queries relating to this Service bulletin should be addressed to: Technical Dept,
International Safety Products L^{td}. Orrell mount, 159 Hawthorne Road, Bootle, Merseyside. L20 6JU. U.K.

Telephone: +44 (0)151 922 2202

Facsimile: +44 (0)151 922 5874